

 FAX: (255 22) 2844300, 2844302 PHONE: (255 22) 2198100 AFS: HTDQYOYO Email: tcaa@tcaa.go.tz, ais@tcaa.go.tz Website: www.tcaa.go.tz	UNITED REPUBLIC OF TANZANIA TANZANIA CIVIL AVIATION AUTHORITY Aeronautical Information Management Nyerere/ Kitunda Road Junction Aviation House, 1st Floor, P.O. Box 2819, DAR ES SALAAM	AIP Supplement 20/26 Published on 25 July 2026
Document No: TCAA/FRM/ANS/AIM - 56	Title: AIP Supplement	Page 1 of 3

AERODROMES (AD)

S20 Musoma Airport– HTMU

Musoma Aerodrome (HTMU) has been undergoing major rehabilitation and upgrading works since 22 October 2021. The project is now in its final stage, with the remaining finalization works expected to be completed by 30 June 2027. The following works have been completed:

- I. Reconstruction and upgrading of the existing Runway 18/36.
- II. Establishing of the new taxiways A and B with 21 and 20 metres width respectively
- III. Establishing of the new aprons, (Isolated and new passengers aprons)
- IV. The reconstructed runway has been extended from 1600 metres to 1705 metres and width of 30 metres.
- V. Establishment of runway strips with dimensions of 1825 x 150 metres

ONGOING WORKS

- I. Construction of new passenger terminal
- II. Construction of aerodrome control tower

AERODROME OPERATIONAL INFORMATION

- I. Pilots to use new passenger apron or isolated apron for aircrafts parking.
- II. All passengers will be taken to existing terminal

Status and condition of RWY 18/36 available for aircraft operations are listed and provided in AD section below.

HTMU AD 2.2 AERODROME GEOGRAPHICAL AND ADMINISTRATIVE DATA

- I. Aerodrome elevation: 3753 FT AMSL
- II. Magnetic variation and annual rate of change: 1° E (2025)/ 0.05° W

HTMU AD 2.8 APRONS, TAXIWAYS AND CHECK LOCATION DATA

1	<i>Apron surface and strength</i>	Isolated apron: Surface: asphalt PCN: Nil New passenger apron: Surface: asphalt PCN: Nil
2	<i>Taxiway width surface and strength</i>	TWY A, 21 M, asphalt, PCN: Nil TWY B, 20 M, asphalt, PCN: Nil
3	<i>ACL location and elevation</i>	Location: Nil Elevation: Nil
4	<i>VOR/INS checkpoint</i>	VOR: Nil
5	<i>Remarks</i>	Nil

HTMU AD 2.12 RUNWAY PHYSICAL CHARACTERISTICS

<i>Designations RWY NR</i>	<i>TRUE & MAG BRG</i>	<i>Dimension s of RWY (M)</i>	<i>Strength (PCN) and surface of RWY and SWY</i>	<i>THR Coordinates</i>	<i>THR elevation and highest elevation of TDZ of precision APP RWY</i>
1	2	3	4	5	6
18	180	1705x30	PCN 15/F/B/Y/U Asphalt	012947.79S 0334806.11E	3720 FT AMSL
36	360	1705x30	PCN 15/F/B/Y/U Asphalt	013013.24S 0334809.14E	3748 FT AMSL
<i>Slope of RWY - SWY</i>	<i>SWY dimensions (M)</i>	<i>CWY dimensions (M)</i>	<i>Strip dimensions (M)</i>	<i>OFZ</i>	<i>Remarks</i>
7	8	9	10	11	12
18 +0.5%	Nil	Nil	1825 x 150	Nil	Nil
36 -0.5%	Nil	Nil	1825 x 150	Nil	Nil

HTMU AD 2.13 DECLARED DISTANCES


<i>RWY Designator</i>	<i>TORA (M)</i>	<i>TODA (M)</i>	<i>ASDA (M)</i>	<i>LDA (M)</i>	<i>Remarks</i>
1	2	3	4	5	6
18	1705	1705	1705	1705	Nil
36	1705	1705	1705	1705	Nil

(Cancel AIP SUP 04/26)

See Attachments to this AIP Supplement

ATTACHMENT TO AIP SUP 20/26

MUSOMA REHABILITATION

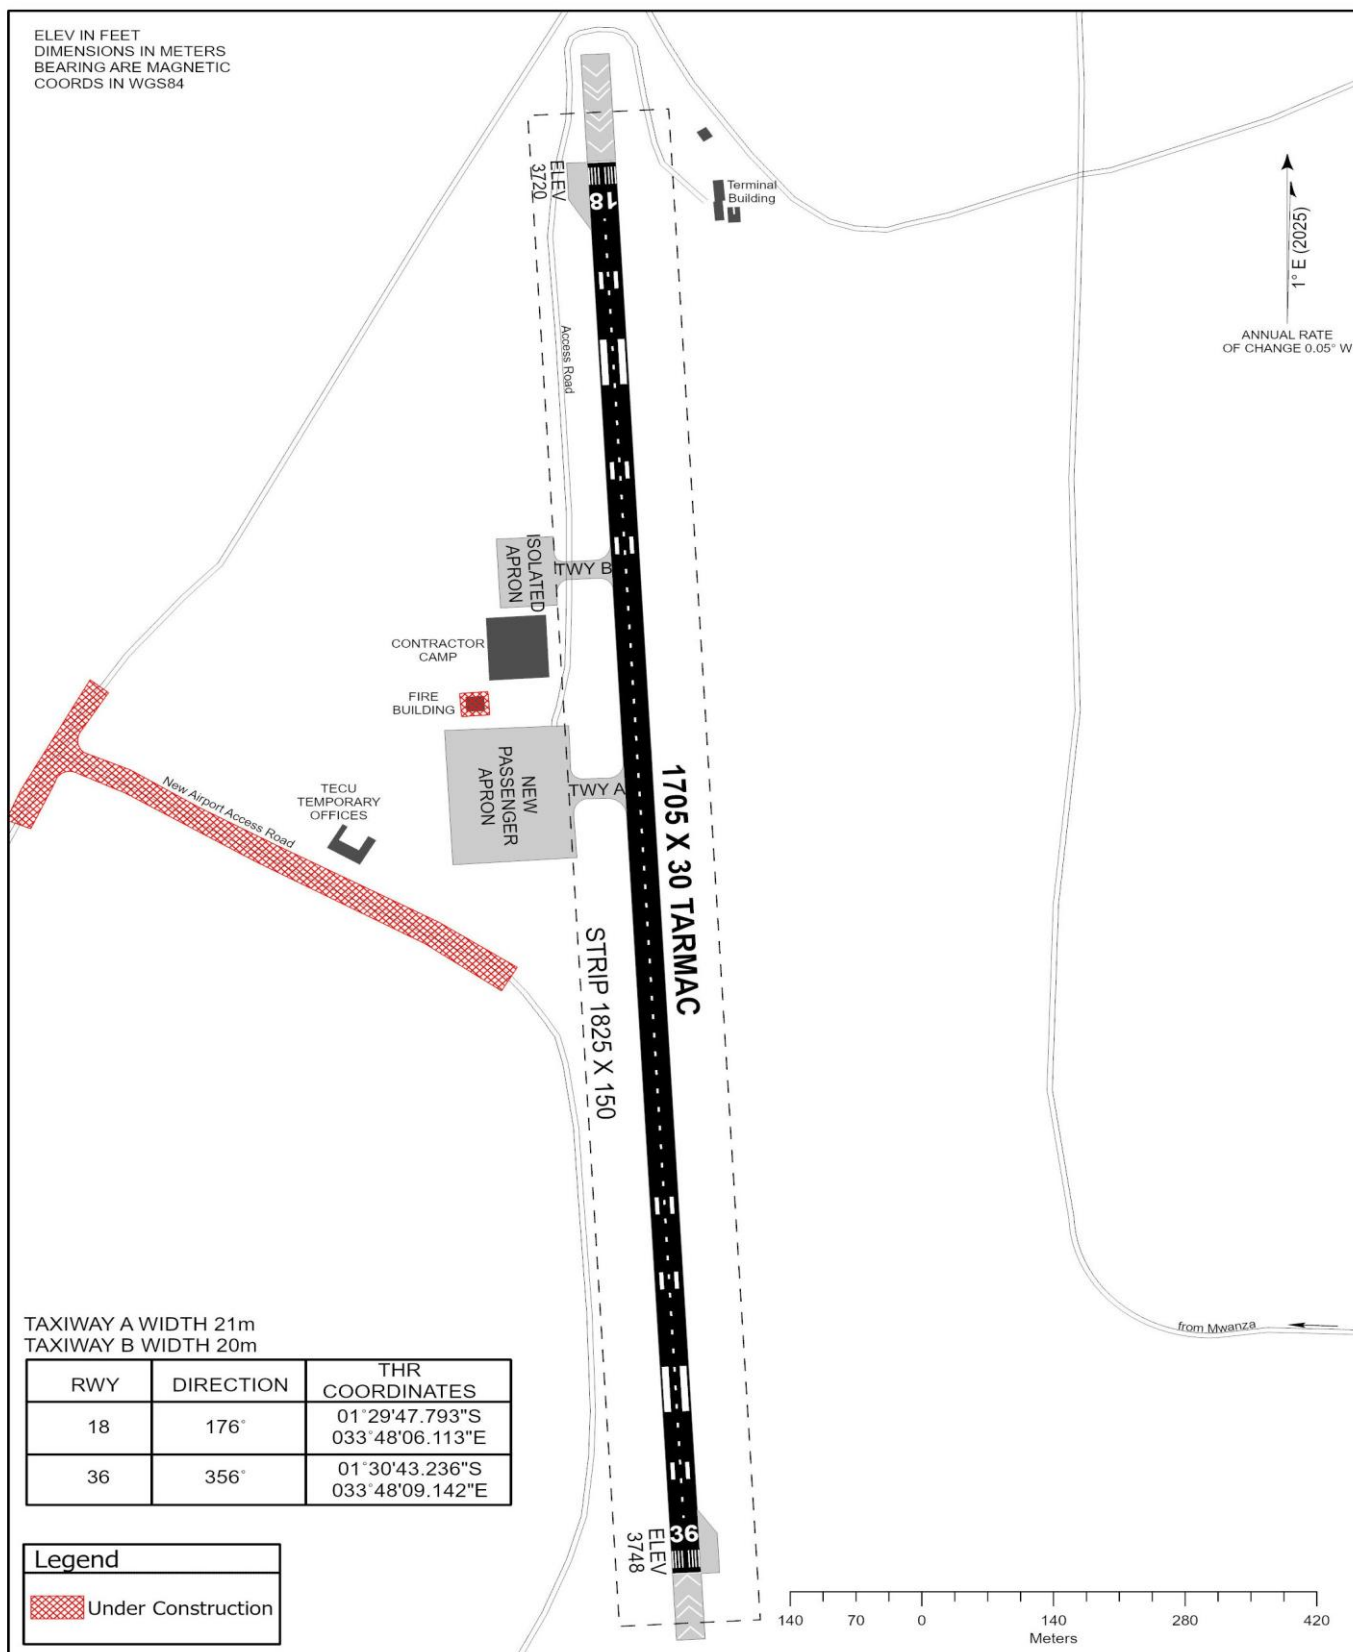

TANZANIA CIVIL AVIATION AUTHORITY

25 July 2026